

Power Steering - Fluid Leak From Reservoir

NO: 64-17

DATE: 4-13-2004

MODEL: S60, S80, All V70 2001-, All X70 1999-

SUBJECT: [Power steering fluid](#) leak at reservoir

REFERENCE: VADIS

<u>Vehicle Type</u>	<u>Plant</u>	<u>Chassis</u>
285	21	403031 -
285	22	404126 -
295	21	144624 -
384	22	372905 -
184	21	360915 -
873	--	047346 -

DESCRIPTION:

Under certain conditions the [power steering](#) system may leak fluid at the reservoir suction hose connection. An improved reservoir was introduced in production from the chassis numbers listed below.

SERVICE:

If the vehicle exhibits this condition and the vehicle is below the chassis # listed above, replace [power steering](#) reservoir (PN 30665496) and hose clamps (PN 976561 & PN 988022).

Note - In order to minimize oil pump noise while turning, over fill the oil until the level is 5 mm below the HOT line on the dipstick. Perform this when [power steering](#) oil is cold.

WARRANTY CLAIM INFORMATION		
<u>LABOR OP</u>	<u>LABOR DESCRIPTION</u>	<u>LABOR TIME</u>
64534-2	replacing the fluid reservoir	0.4 hr

Claims may be submitted under the new car warranty when there is a documented customer complaint using claim type: 01

Warranty Claim Information