

Steering - Power Steering Reservoir Fluid Leak

NO: 64-17

DATE: 8-24-2007

MODEL & MODEL YEAR:

S60 2001-

S80 1999-2006

V70 2001-2007

XC70 2001-2007

XC90 2003-

SUBJECT:

[Power steering fluid](#) leak at reservoir

REFERENCE:

VIDA

THIS TNN SUPERSEDES TNN 64-17 DATED 6-27-2007. THE CLAMP PART NUMBERS HAVE CHANGED. PLEASE UPDATE YOUR FILES.

Description

Under certain conditions the power steering may leak fluid at the reservoir suction hose connection. An improved suction hose was introduced into production in December 2004.

Service

If there is leakage at the reservoir/suction hose connection on the above vehicles, replace the suction hose and clamps only, according to VIDA.

Use the following parts:

^ Hose: as per VIDA

^ Clamps: quantity (2) pn 988024

Note! These hose clamps are screw-type clamps. Do not use a crimp-style hose clamp for this repair.

After replacing the hose and clamps, top up the fluid level (see below), and check for leaks. If the leakage is still present, only then should you replace the reservoir.

When checking and topping up the fluid level in the reservoir after the repair, measure when cold and with the engine turned off. Fill the oil until the level is halfway between the 'cold' and 'hot' marks on the dipstick.

Note! The Service Advisor and Warranty Administrator should include as much customer information on the Repair Order and warranty claim text as possible. Warranty claims which lack sufficient detail regarding 3 C's (complaint/cause/correction) may be subject to further warranty review and debit.

WARRANTY CLAIM INFORMATION		
<u>LABOR OP</u>	<u>LABOR DESCRIPTION</u>	<u>LABOR TIME</u>
64537-2	replace suction hose, fluid reservoir, PS pump	0.4 hr.

Claims may be submitted under the new car warranty when there is a documented customer complaint using claim type: 01